S-217 Costen Tenant House No. 2 Near Wellington Private

c. 1800-1815

Architecturally, this small frame house that stands abandoned in an open field is one of the most significant one-room plan houses to survive in Somerset County. Despite its diminutive size, both the exterior and interior details surpass the architectural sophistication found on much larger houses. The pedimented entrance is complimented by a delicate modillioned cornice. Also surviving are original 12/12 and 12/8 sash windows. Inside the first floor room has flat-panel wainscoting and a tight winder stair. The adjacent single-story kitchen wing is also worthy of note with its interior horizontal board sheathing and exposed beaded joists.

Architectural features point to a c. 1800-1815 date of construction but little else is known about the early history and occupants. The house stands on part of "Costen's Care," a tract of land owned and farmed in the 17th, 18th and 19th centuries by various generations of the Costen family. The first mention of this specific house is located in the Chancery Court papers, drawn up to settle William M.N.B. Costen's estate in 1892.

The land on which this house stands was apportioned to Marietta Costen Clarke, widow of Edward H. Clarke of Worcester County. It is not known whether Mrs. Clarke ever occupied the house.

Maryland Historical Trust State Historic Sites Inventory Form

Survey No.
S-217

Magi No.
2002175304

DOE __yes __no

1. Nam	1e (indicate pr	eferred name)		
historic				
and/or common	G4	.sa No. 2		
2. Loca	<u> Costen Tenant Ho</u> ation	ise No. 4		
street & number	Vegt Side of Cole	ahuma Daril		mak from the billion
city, town	West Side of Coke Wellington	_X_ vicinity of	congressional district	not for publication First
state	Maryland	county	Somerset	
3. Clas	sification			
Category district _X_ bullding(s) structure site object	Ownership publicX_ private both Public Acquisition in process being considered not_applicable	Status — occupied — unoccupied — work in progress Accessible — yes: restricted — yes: unrestricted — no	Present Use agriculture commercial educational entertainment government industrial military	museum park private residence religious scientific transportation other:
4. Own	er of Prope	rty (give names a	nd mailing addresses	of <u>all</u> owners)
name	James Cottman			
street & number			telephone no	.:
city, town	Princess Anne	state	and zip code MD 2	1853
5. Loca	ition of Lega	al Description		
courthouse, regis	stry of deeds, etc. Somer	set Clerk of Court		liber
street & number	Somerset County C	ourthouse		folio
city, town	Princess Anne		state	MD 21853
6. Repr	esentation	in Existing	Historical Surve	
title				
date			federal state	county local
pository for sur	vey records			
city, town			state	

7. Description
/. Description

Survey No. S-217

Condition — excellent — good — ruins — fair — unexposed	Itered X original site	of move
--	------------------------	---------

Prepare both a summary paragraph and a general description of the resource and its various elements as it exists today.

The Costen Tenant House is a c. 1800-1810 two-story, three-bay frame house located in the middle of a plowed field west of Cokesbury Road, near Wellington, Somerset County, MD. The house faces north with the gable running on an east/west axis.

Supported by a common bond brick foundation, the two-story frame house is sheathed with a combination of plain and beaded weatherboards and covered with a medium sloped wood shingle roof. The two-story house consists of two sections. The c. 1800-1810 one-room plan house was enlarged with a two-story, one-room plan addition around 1890-1900. The roof to this portion has fallen in. Extending to the rear of the turn-of-the 20th century addition is a single story one-room plan kitchen wing which appears to date from the same period as the main house.

The north (main) elevation is three bays across with the western two bays comprising the c. 1800-1810 house. A pedimented entrance with a semi-circular transom light and dentil molding under the cornice tops a raised six-panel door. Directly west (to the right) of the entrance bay is a 12/12 sash window and located above are two 12/8 sash windows. Stretching across at the base of the roof is a finely crafted boxed cornice, embellished with crown molding, end boards and delicate modillion blocks. In addition the facia is scored with a pattern of vertical lines interupted by six-point stars. Under the modillions is a row of dentils. The c. 1890-1900 addition is lighted on both floors by 2/2 sash windows. The roof has fallen in.

The west gable end of the house is plainly finished with a combination of beaded and plain weatherboards. Two seams in the siding to the right of the internal chimney in the location of previous windows. A small window opening still lights the attic to the right of the stack. A molded barge board finishes the gable end, while a narrow brick chimney is finished with a corbelled cap.

The south side of the house is detailed in a similar manner but without as much decoration around the door. The six-panel back door is framed by a simple door surround. Window openings remain in the same location but only one section of sash remains in place. The cornice is finished with the same end boards, modillion blocks and dentils, but the fascia was left plain. The south side of the c. 1890-1900 addition is primarily covered by the single-story kitchen wing, which rests on a brick pier foundation and is sheathed with a combination of beaded and plain weatherboards. The west side of the kitchen has two openings. A six over six window pierces the left bay, while an old door opening (now window) occupies the right bay.

The south gable end of the kitchen has a single door opening on the first floor and a single window opening on the second floor. The door is located to the right of the internal brick stack, while the window is located to the left.

The east side of the kitchen wing is pierced by two window openings, one of which has been boarded up.

Inside the c. 1800-1810 portion, the first floor walls are covered with flat panel wainscoting below the chair rail. Ovolo molded back band surrounds the frame the east wall door as well as the door openings on the front and rear walls. The entrance transom is treated in a special way with a decorative keystone block that interupts the header molding. The transom muntins spread out in a radiating spoke pattern.

The stair is located in the northwest corner with three exposed steps. The remaining winder stair is enclosed behing by a flush six-panel door with spring lock. The mantel has been removed as have the stair balusters and handrail.

The stair rises under a sloped plaster soffit to the second floor. The second frail and covered with plaster over riven oak lath and finished with simply molded chair rail and baseboard. The stair continues to the unfinished attic. Each pair of sawn raf-

Period preh 1400	istoric 1499 1599 1699 1799 1899	Areas of Significance— archeology-prehistoric archeology-historic agriculture architecture art commerce communications		commun conserva economic education engineer	ity planning itlon cs n ing on/settleme	g la la lit m m	erature ilitary usic	ture religion science sculpture social/ humanitariai theater	on
Specific	dates		Build	der/Arch	itect			(_
check:	aı	icable Criteria:And/or icable Exception:				_E _F	G		
		of Significance:							
Prepare	both	a summary paragraph	of si	gnific	ance and	l a gene	ral statement	t of history and	 1

Architecturally, this small frame house is one of the most significant one-room plan houses to survive in Somerset County. Despite its diminutive size, both the exterior and interior details surpass the sophistication found on much larger houses. The pedimented entrance is complimented by a delicate modillioned cornice. Also

surviving are original 12/12 and 12/48 sash windows. Inside, the first floor has flat-panel wainscoting and a tight winder stair.

Significance

support.

The single story kitchen wing is also worthy of note with its interior horizontal and sheathing and exposed beaded joists.

Architectural features point to a c. 1800-1810 date of construction, but little else is known about the early history and occupants. The house stands on part of "Costen's Care", a tract of land owned in the 17th, 18th and 19th centuries by various generations of the Costen family. The first mention of a house at this location is recorded in the Chancery Court papers, drawn up to settle William M.N.B. Costen's estate in 1892. The land on which this house stands was apportioned to Marietta Costen Clarke, widow of Edward H. Clarke of Worcester County. It is not known whether Mrs. Clarke ever occupied the house.

9. Major Bibliographical References

10. Ge	ographical Data		
Acreage of nomi Quadrangle nam UTM References		ces	Quadrangle scale
A Zone Easti	ng Northing	B Zon	e Easting Northing
C		D F Ĥ	
Verbal bounda	ry description and justification		
List all states	and counties for properties overlap	ping state o	r county boundaries
state	code	county	code
state	code	county	code
11. For	rm Prepared By		
name/title	Paul Touart - Architectural	Historia	,: n
organization	Somerset County Historical	Trust	date 4/22/84
street & number	424 North Somerset Avenue		telephone 651-1094 (Home)
city or town	Princess Anne	·	state Maryland 21853

The Maryland Historic Sites Inventory was officially created by an Act of the Maryland Legislature to be found in the Annotated Code of Maryland, Article 41, Section 181 KA, 1974 supplement.

The survey and inventory are being prepared for information and record purposes only and do not constitute any infringement of individual property rights.

return to:

Maryland Historical Trust

Shaw House

21 State Circle

Annapolis, Maryland 21401

(301) 269-2438

ters is stabilized by a collar beam with a half-dovetailed lap joint and a double-struck cut nail. Lying on the attic floor is a board and batten door with a pair of butterfly hinges. The hinges were evidently reused.

The interior finish of the c. 1890-1900 addition consists primarily of plaster walls and simple baseboards. The kitchen, on the other hand, survives with portions of horizontal board siding and beaded floor joists. An enclosed stair rises in the southwest corner to the loft above. The kitchen has been rebuilt, but empty mortises on the north gable end the beam indicates the previous gable end wall studs.





Costen Tenant House No. 2
Near Cokesbury, Somerset County
South Elewation
2/84 Paul Touart
Neg./Maryland Historic Trust



Costen Tenant House No. 2 Near Cokesbury, Somerset County Northwest Corner 2/84 Paul Touart Neg./ Maryland Historic Trust



Costen Tenant House No.2 Near Cokesbury, Somerset County South Elevation 2/84 Paul Touart Neg./ Maryland Historic Trust



Costen Tenant House No.2 Near Cokesbury, Somerset County North Elevation 2/84 Paul Touart Neg./ Maryland Historic Trust



Costen Tenant House No. 2 Near Cokesbury, Somerset County Eave Detail 2/84 Paul Touart Neg./Maryland Historic Trust



Costen Tenant House No.2 Near Cokesbury, Somerset County Cornice Detail 2/84 Paul Touart Neg./ Maryland Historic Trust



S - 217

Costen Tenant House No. 2
Near Cokesbury , Somerset County
East Elevation
5/84 Paul Touart
Neg./Maryland Historic Trust

NORTHWET CHENER



William Costen Tenant House No. 2 Near Cokesbury, Somerset County North Cornice Photographer, Paul Touart, 1/85 Neg./MD Historical Trust S-217



Wellington vicinity, Somerset Co., Md.

Costen Tenant House No. 2 S-217

2/86, Paul Touart, Photographer

Arched Chimney Support

Neg./Md. Historical Trust



Costen Tenant House No. 2 Near Cokesbury, Somerset County West Elevation 2/84 Paul Touart Neg./ Maryland Historic Trust




William Costen Tenant House No. 2 S-217
Near Cokesbury, Somerset County
Northwest corner
Photographer, Paul Touart, 1/85
Neg./MD Historical Trust



William Costen Tenant House No. 2 S-217
Near Wellington, Somerset County
Front Door-North Elevation
2/84 Paul Touart
Neg/MD. Historical Trust



Costen Tenant House No.2 Near Cokesbury, Somerset County Front Door-North Elevation 2/84 Paul Touart Neg./ Maryland Historic Trust

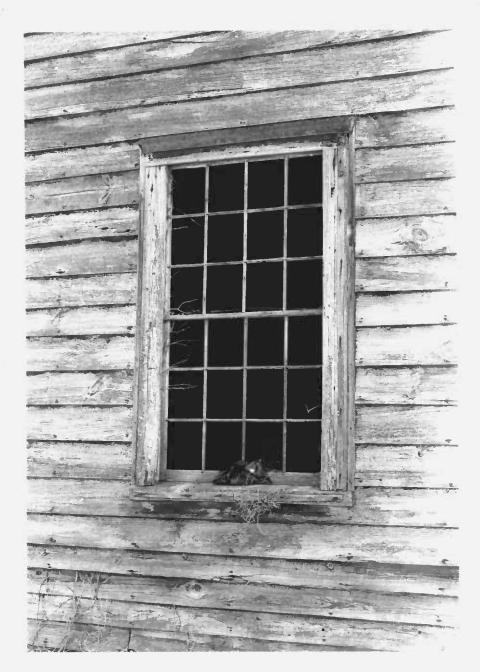


Costen Tenant House No.2 Near Cokesbury, Somerset County North Window 2/84 Paul Touart Neg./ Maryland Historic Trust



S 217

Costen Tenant House No. 2
Near Cokesbury, Somerset County
Front Door Transom
2/84 Paul Touart
Neg./ Maryland Historic Trust

Burrelling Albert

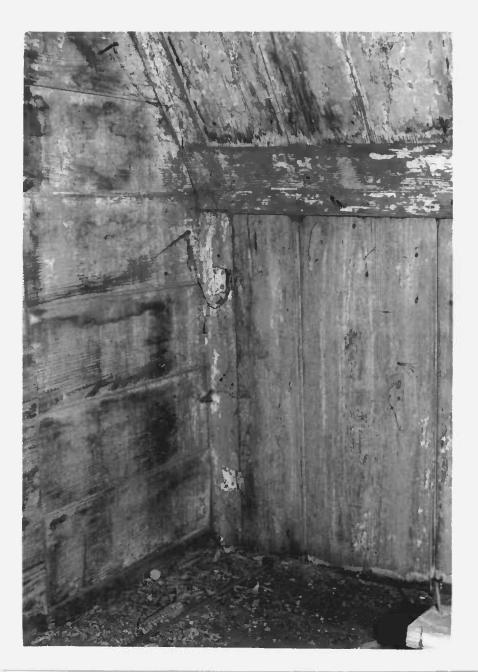

William Costen Tenant House No. 2 S-217
Near Cokesbury, Somerset County
Butterfly Hinges
Photographer, Paul Touart, 1/85
Neg./MD Historical Trust



Costen Tenant House No.2 Near Cokesbury, Somerset County 2nd floor stair 2/84 Paul Touart Neg./ Maryland Historic Trust



S-217

Costen Tenant House No.1 Near Cokesbury, Somerset County

Mestallevation 2/1/2 122/ 1/1/16

5/84 Paul Touart

Neg./ Maryland Historic Trust



S-217

Costen Tenant House No. 2 Near Cokesbury, Somerset County Corner Stair 2/84 Paul Touart Neg./ Maryland Historic Trust



Costen Tenant House No.2 Near Cokesbury, Somerset County Corner Stair


2/84 Paul Touart Neg./ Maryland Historic Trust



William Costen Tenant House No. 2 S-217
Near Cokesbury, Somerset County
Ell corner posts
Photographer, Paul Touart, 1/85
Neg./MD Historical Trust



Costen Tenant House No. 2
Near Cokesbury Somerset County
Front Door Transom
2/84 Paul Touart
Neg./ Maryland Historic Trust

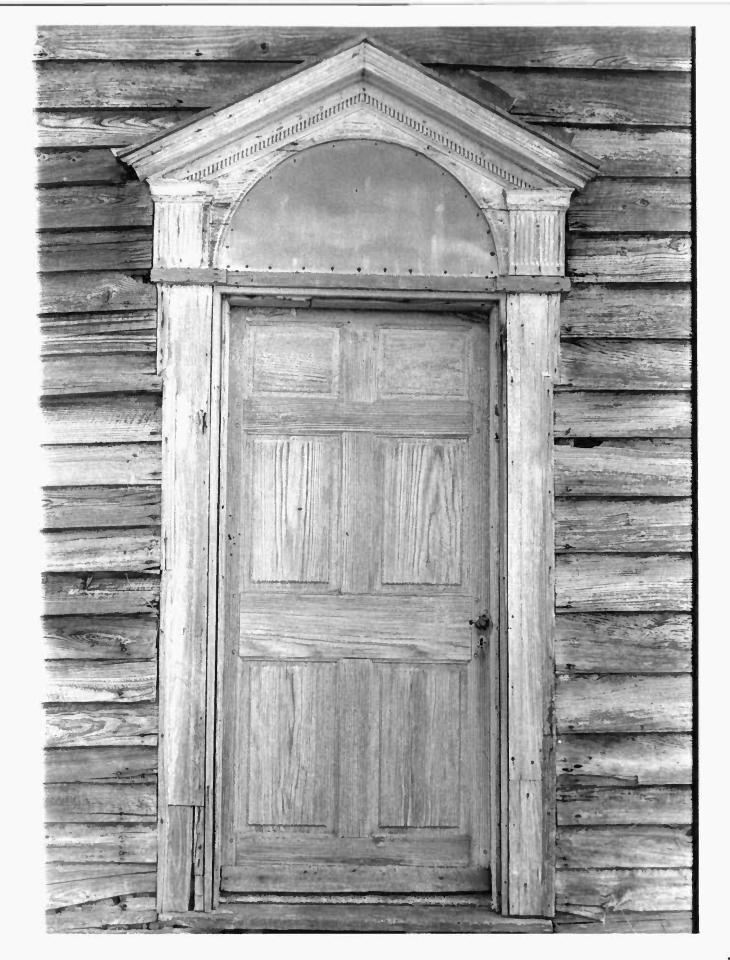

William Costen Tenant House No. 2 S-217
Near Wellington, Somerset County
Front Door
2/84 Paul Touart
Neg./MD Historical Trust



William Costen Tenant House No. 2 S-217
Near Wellington, Somerset County
Cornice - South Elevation
2/84 Paul Touart
Neg./MD Historical Trust